


MONUMENT RECORD

Corner ID: **CICr_G01**

North 1/4 Corner



Section 05- T07N-R01W, 2nd P.M.

Clear Creek Township, Monroe County, Indiana

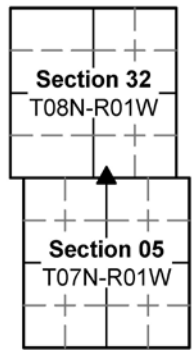

MONUMENT: Describe monument set or found (Include material type, scribing, distance above/below grade, dimensions.)
1/2" iron pipe found with broken yellow plastic cap stamped "PRALL LS1023"

MONUMENT LOCATION SKETCH:

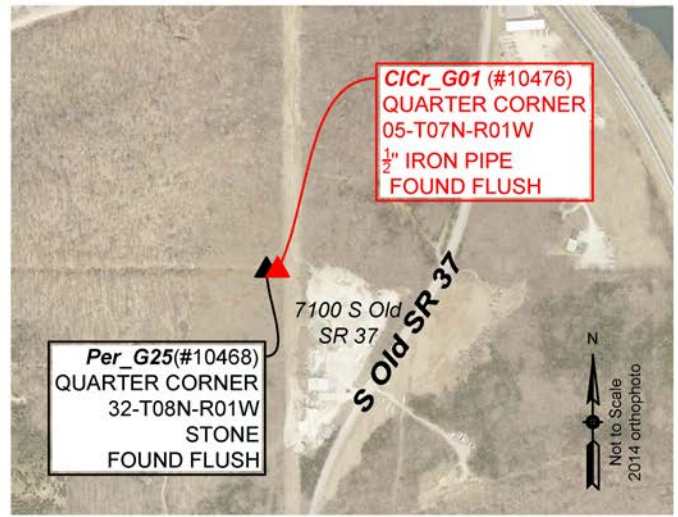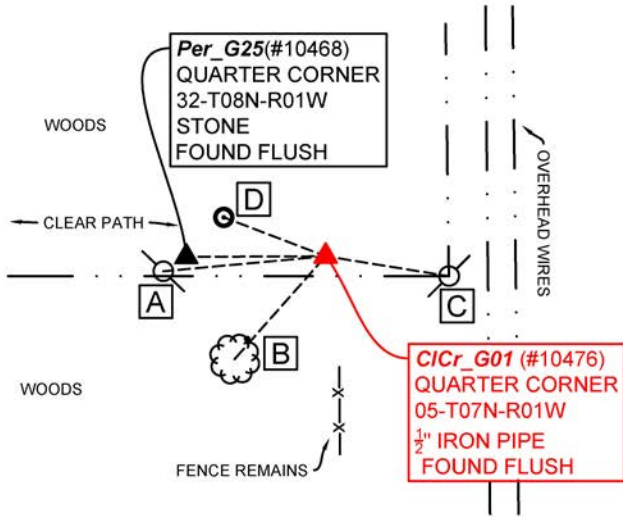

WITNESS MONUMENT TIES

All ties to new Bearing Trees (BTs) are a mag nail set in a 1-1/2" plastic washer stamped "SURVEY MARKER - DO NOT REMOVE" and hack mark at the root crown (less than 12" above ground) perpendicular to the center of the tree, unless otherwise noted. BT diameters are noted as dbh and are measured approximately 4.5' above ground. Bearings are measured from the monument to the center of the BT, distances are measured from the monument to the mag nail.

ID	BEARING	DISTANCE	DESCRIPTION
Witness A	S 85d W	68.0'	Mag nail and flagging found 1.2' above grade in the east side of a 9" power pole "175--034"
Witness B	S 42d W	57.2'	Mag nail and washer set in hack 0.5' above grade in the northeast side of a 13" white oak
Witness C	S 81d E	52.0'	Mag nail and flagging found 1.2' above grade in the west side of a Cinergy utility pole "115-033"
Witness D	N 69d W	45.4'	8" x 8" cut limestone found flush. Broken, no disk, with a brass plug on top.
(#10468)	S 89d44'22" W	58.03	Stone found flush at Per_G25, south $\frac{1}{4}$ corner of section 32 in Perry township.



OFFICE OF THE MONROE COUNTY SURVEYOR • Trohn Enright-Randolph

119 W 7th Street, Bloomington, IN 47404 • 812-349-2570 • surveyorsoffice@co.monroe.in.us

Page 1 of 3

MONUMENT RECORD

Corner ID: **CICr_G01**

North 1/4 Corner

Section 05- T07N-R01W, 2nd P.M.

Clear Creek Township, Monroe County, Indiana

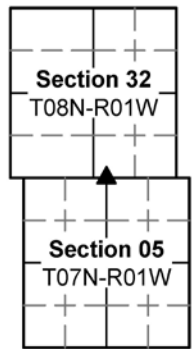


PHOTO IDENTIFIED: Photo Date: 4/30/2018



Photo Orientation & Description: CICr_G01 from above



Photo Orientation & Description: Looking north at CICr_G01



Photo Orientation & Description: Looking south at CICr_G01



Photo Orientation & Description: Looking west at CICr_G01

ORIGINAL OR SUBSEQUENT SURVEY EVIDENCE FOUND: Include, search area or areas, search procedure, etc.

Date of Field work/Search: 4/30/2018 By: RSO & CAR Monument Found: 1/2" iron pipe BTs or Reference Objects Found: Witnesses B-D found per current MCS tie sheet Project #: CICr_2018 Field Book: 52/3 Equipment: Coordinate data was collected with a Javad Triumph LS Network Rover. The basis of bearings is Grid North NAD83(2011), Indiana West Zone, Epoch 2010.0000, Geoid Model G2012BU7, Datum NAD83 NO_TRANS, US Survey Feet, derived from GPS observations utilizing the Indiana Real-Time Network (INCORS). Distances obtained with GPS have not been adjusted to ground. Coordinates are available upon request. Notes:

OTHER EVIDENCE: Describe corner location relative to nearby features and how to reach the corner location – note fences, roads, timber cutting lines, mow lines, clearings, plantings, streams, topo changes, etc.

The monument(s) are located northwest of the quarry at 7100 S Old SR 37. It is in the clear pathway where the powerlines run north, south, and west.

MONUMENT PRESERVATION: Describe work done to preserve existing monument.

Took new ties. Spray painted orange. A t-post was set 0.25' north of the monument 2.8' above grade facing south



OFFICE OF THE MONROE COUNTY SURVEYOR • Trohn Enright-Randolph

119 W 7th Street, Bloomington, IN 47404 • 812-349-2570 • surveyorsoffice@co.monroe.in.us

Page 2 of 3


MONUMENT RECORD

Corner ID: **CICr_G01**

North 1/4 Corner

Section 05- T07N-R01W, 2nd P.M.

Clear Creek Township, Monroe County, Indiana

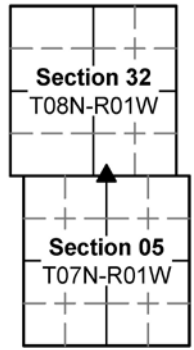

THEORY OF LOCATION: *Describe the theory of location for acceptance of this monument. Include monument origin and associated uncertainty.*
The 1/2" iron pipe with yellow plastic cap was previously witnessed by the State Highway Survey Location Team and Recovery Tie prepared on December 07, 1987. The 1987 Recovery Tie accepted the 1/2" iron pipe with yellow plastic cap. The 1/2" iron pipe with yellow plastic cap was previously witnessed and Recovery Tie Drawing prepared under the direction of the Monroe County Surveyor, Steven V. Farkas, on December, 1987. The 1987 Recovery Tie Drawing accepted the 1/2" iron pipe with yellow plastic cap.

CERTIFICATIONS:



Date:10/26/2020
Trohn Enright-Randolph
Monroe County Surveyor



Date:10/22/2020
Accepted by the Monroe
County Surveyor Review
Board



OFFICE OF THE MONROE COUNTY SURVEYOR • Trohn Enright-Randolph

119 W 7th Street, Bloomington, IN 47404 • 812-349-2570 • surveyoroffice@co.monroe.in.us


Page 3 of 3

SECTION 5, TOWNSHIP 7 N, RANGE 1 W

MONUMENT DESCRIPTION & REMARKS

FOUND 1/2" IRON PIPE WITH YELLOW PLASTIC PLUG

RECOVERY TIE DRAWING

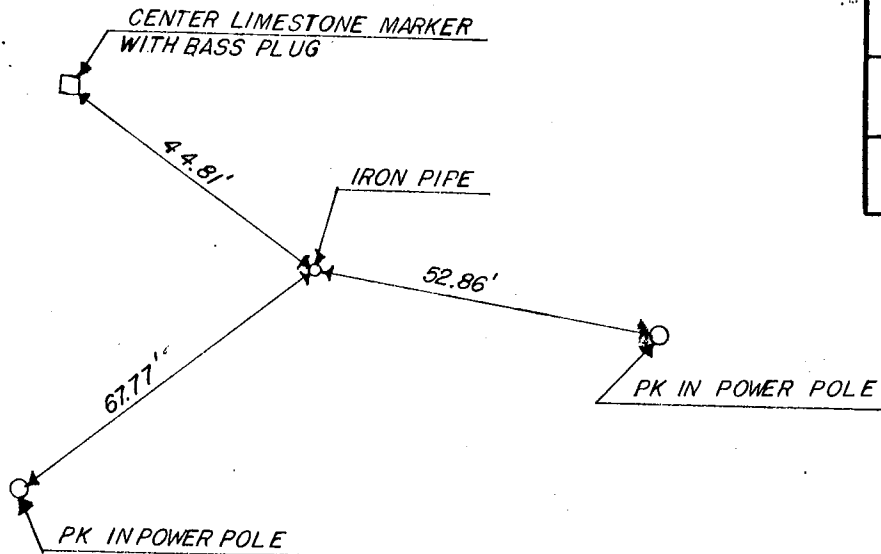

(●) AT CORNER



NOT TO SCALE

STATE OF INDIANA

COUNTY OF MONROE

I, EDMUND O. FARKAS HEREBY CERTIFY THAT THIS DOCUMENT WAS PREPARED UNDER MY DIRECTION IN ACCORDANCE WITH THE PROVISIONS OF SECTION 17-3-64-4 - 17-3-64-8 OF THE INDIANA CODE, BEING ACTS OF 1965, CHAPTER 319; AND THE ABOVE DATA IS GIVEN UNDER MY HAND AND SEAL THIS DAY OF DECEMBER, 19 87 A.D.

SPACE
RESERVED
FOR
RECORDING
OFFICER.

INDIANA REGISTERED LAND SURVEYOR NO. OR

UNITED STATES GOVERNMENT AGENCY

TOWNSHIP:
CLEAR CREEK


CORNER I.D.

TITLE

G-1

CORNER ID # G-1

SEC. 5 T-7-N R-1-W
CLEAR CREEK TWP.
MONROE CO.

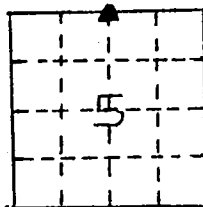

1/2" I. PIPE w/
Type Monument YELLOW PLAS. PLUG (END)
Depth FLUSH w/ GRD.
By S.P. #3 & R.I. WILLIAMS
Date DEC. 7, 1987

CENTER
LIMESTONE
MKE. w/ BRASS
PLUG



44.81'

67.77'

P.K.N. IN
P.W.P.

N

52.86'

P.K.N. IN
P.W.P.

State Form 40180

Recovery Tie Submitted by: State Highway Survey Location Team